

Open Loop Hall AC/DC Current Sensor CYHCS-FA

This Hall Effect current sensor is based on open loop principle and designed with a high galvanic isolation between primary conductor and secondary circuit. It can be used for measurement of DC and AC current, pulse currents etc. The output of the transducer reflects the real wave of the current carrying conductor.

Product Characteristics	Applications
<ul style="list-style-type: none"> • Excellent accuracy • Very good linearity • Small size • Light in weight • Less power consumption • Window structure • Electrically isolating the output of the transducer from the current carrying conductor • No insertion loss • Current overload capability 	<ul style="list-style-type: none"> • Photovoltaic equipment • Frequency conversion timing equipment • Various power supply • Uninterruptible power supplies (UPS) • Electric welding machines • Transformer substation • Numerical controlled machine tools • Electrolyzing and electroplating equipment • Electric powered locomotive • Microcomputer monitoring • Electric power network monitoring

Electrical Data

Primary Nominal Current I_r (A)	Measuring Range (A)	Output voltage (Analog) (V)	Window Size (mm)	Part number
400	±800	X=0: ±4V ±1.0% X=1: ±5V ±1.0%	51x13	CYHCS-FA400A-X
500	±1000			CYHCS-FA500A-X
600	±1200			CYHCS-FA600A-X
800	±1600			CYHCS-FA800A-X
1000	±2000			CYHCS-FA1000A-X
1500	±2500			CYHCS-FA1500A-X
2000	±2500			CYHCS-FA2000A-X


Supply Voltage
Current Consumption
Galvanic isolation, 50/60Hz, 1min:
Load resistance:
Isolation resistance @ 500 VDC

$V_{cc} = \pm 12 \sim \pm 15V \pm 5\%$
 $I_c < 25mA$
3kV rms
10kΩ
> 500 MΩ

Accuracy and Dynamic performance data

Accuracy at I_r , $T_A=25^\circ C$ (without offset),
Linearity from 0 to I_r , $T_A=25^\circ C$,
Electric Offset Voltage, $T_A=25^\circ C$,
Magnetic Offset Voltage ($I_r \rightarrow 0$)
Thermal Drift of Offset Voltage,
Thermal Drift (-10°C to 50°C),
Frequency bandwidth (-3 dB):
Response Time at 90% of I_P ($f=1k$ Hz)

$E < \pm 1.0\%$
 $E_L < \pm 0.5\%$ FS
 $V_{oe} < \pm 25mV$
 $V_{om} < \pm 25mV$
 $V_{ot} < \pm 1.0mV/^\circ C$
T.C. < ±0.1% /°C
DC-20kHz
 $t_r < 7\mu s$



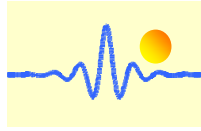


General Data

Ambient Operating Temperature,
Ambient Storage Temperature,
Unit weight:

$T_A = -25^{\circ}\text{C} \sim +85^{\circ}\text{C}$
 $T_S = -40^{\circ}\text{C} \sim +100^{\circ}\text{C}$
300g/unit

Dimensions

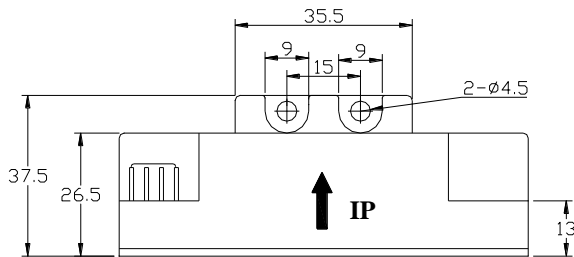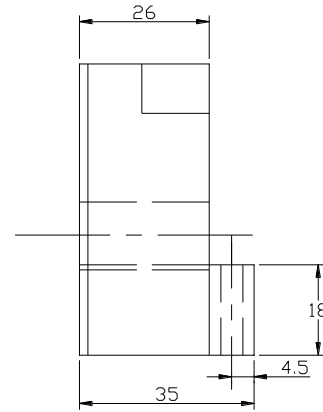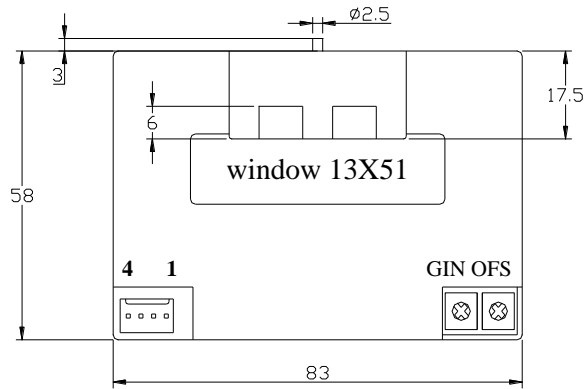

Pin Arrangement

1: +15V
2: -15V
3: Output
4: Ground
GIN: gain adjustment
OFS: offset adjustment



Notes:

1. Connect the terminals of power source, output respectively and correctly, never make wrong connection.
2. Two potentiometers can be adjusted, only if necessary, by turning slowly to the required accuracy with a small screwdriver.
3. The best accuracy can be achieved when the window is fully filled with bus-bar (current carrying conductor).
4. The in-phase output can be obtained when the direction of current of current carrying conductor is the same as the direction of arrow marked on the transducer